

Site Accessibility Evaluation



North Creek Park
1015 Jackson Rd
Goodlettsville, TN 37072

ADA Only

Inspection Date: 12/21/2017
Inspector: Shelley Zuniga

Prepared By
WT Group

Engineering with Precision, Pace & Passion.
(224) 293 - 6451
www.wtengineering.com

April 13, 2018

Amy Mitchell
Director of Parks and Recreation
City of Goodlettsville
105 South Main St.
Goodlettsville, TN, 37072

Dear Amy:

Thank you for the opportunity to be of service to you by performing an accessibility evaluation for the North Creek Park located at 1015 Jackson Rd, Goodlettsville, TN, 37072. The facility was inspected on 12/21/2017.

We recommended that all barriers that are identified in this evaluation recommended in one of the phases below, be removed as soon as possible. A transition plan should be developed to assist in planning the removal of all barriers. To help with this, we have identified all barriers on a finding by finding basis with a phase identifier as follows:

1 (Phase 1): Should be completed immediately. This category includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat.

2 (Phase 2): Should be completed as soon as possible. Includes findings that would remove barriers to the greatest number of people to your goods and services and finding new to the technical standards such as recreation elements

3 (Phase 3): Should be completed as soon as possible, but there may be other items that will provide greater access to persons with disabilities. This category includes findings that have a high financial impact on the entity, are subject to standards not yet final, or involve a partner entity.

4 (Option): Not necessary to complete, because other sites exist that meet Title II requirements for program access, or retrofit is technically infeasible, or variance is a construction tolerance.

5 (Smart Practice): Should be completed but not necessarily required. This category includes findings and or elements that were in compliance with previous editions of the codes and standards but have since changed. This category also includes techniques or elements that are not a part of the federal or state requirements, but are suggested in advisory language, or have been successfully implemented by other entities. Generally, these items are easily modified to provide the greatest degree of access as well as compliance with the most current codes and standards.




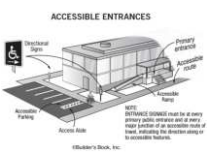

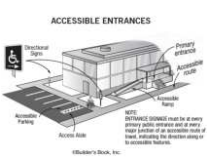
Periodic maintenance to ensure continued accessibility is essential in providing a safe and usable environment. Parking lot markings, signage, door opening pressures, and maintaining clear floor space at doors and other elements and fixtures, available to the public, must be part of an ongoing maintenance schedule.

If you have any questions regarding this report or would like to schedule a meeting with myself and your architect, attorney, or contractor, please feel free to contact me.


Sincerely,

Shelley Zuniga
Shelley Zuniga

North Creek Park - 1015 Jackson Rd Goodlettsville, TN 37072

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Phase	Photo	Figure
1	Parking	36.3285569127/ -86.7006542884	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of unknown parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	gravel lot lacks marked stalls	Leave as is, and designate other sites in the city as accessible	2015 ABAAS Section: F208.2 2010 ADAS Section: 208.2 1991 ADAAG Section: 4.1.2 1991 ADAS Section: 4.1.2	Option (4)		
2	Park Site	36.3281702157/ -86.7012202345	There is no accessible route to the ball field. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	ball field back stops lack AR	Leave as is, and designate other sites in the city as accessible	2015 ABAAS Section: F206.2.2 2010 ADAS Section: 206.2.2 1991 ADAAG Section: 4.1.2 1991 ADAS Section: 4.1.2	Option (4)		
3	Park Site	36.3279051541/ -86.7028644286	There is no accessible route to the soccer field. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	soccer field lacks AR	Leave as is and designate other fields in the city as accessible	2015 ABAAS Section: F206.2.2 2010 ADAS Section: 206.2.2 1991 ADAAG Section: 4.1.2 1991 ADAS Section: 4.1.2	Option (4)		

North Creek Park - 1015 Jackson Rd Goodlettsville, TN 37072

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Phase	Photo	Figure
4	Park Site	36.3279691521/ -86.7010941706	36 inches (915 mm) by 48 inches (1220 mm) positioned near the bench with one side of the space adjoining an outdoor recreation access route or trail, as applicable The clear ground space shall not overlap the outdoor recreation access route or trail, or another clear ground space	3 benches lack AR and CFS	Leave as is, and designate other sites in the city as accessible	2015 ABAAS Section: 1011.2, 1011.2.1	Option (4)		
5	Park Site	36.3282225113/ -86.7007910810	There is no accessible route to the bike rack. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no AR to bike rack	Leave as is, and designate other sites in the city as accessible	2015 ABAAS Section: F206.2.2 2010 ADAS Section: 206.2.2 1991 ADAAG Section: 4.1.2 1991 ADAS Section: 4.1.2	Option (4)	